

# TECHNICAL SERVICE BULLETIN

SUBJECT: <b>WINDSHIELD CREAKING NOISE WHILE DRIVING</b>			No: <b>TSB-05-42A-005</b>
			DATE: <b>March, 2005</b>
			MODEL: <b>See below</b>
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input checked="" type="checkbox"/> WARRANTY PROCESSOR	<input type="checkbox"/> SALES MANAGER

## PURPOSE

A creaking or rattling noise may be heard while driving, coming from the "A" pillar area, due to the windshield moulding clips vibrating against the glass. Eliminate the noise by installing a small piece of felt material on the side windshield moulding inner clips, as described in this bulletin.

## AFFECTED VEHICLES

2002 -05 Lancer  
2003 -05 Lancer Evolution


## PROCEDURE

1. Test drive the vehicle to verify the noise is coming from the "A" pillar area.



2. Use a soft trim stick to remove the side windshield moulding from the cowl trim as shown. Do not remove the cowl trim for this procedure.
3. Obtain **adhesive-backed thin felt material** from the BSR kit listed in the PARTS INFORMATION section of this bulletin.

Cut six felt pieces, approximately **70 mm X 5 mm**.

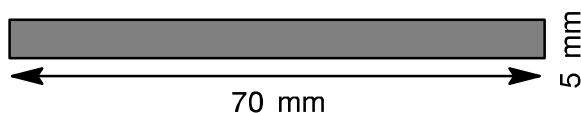

4. Remove the liner from the back of the felt pieces. Affix the felt on the inner clips as shown.


Affix one felt piece to each of the three inner clips.

Repeat on the other side.

FILE UNDER:

Group 42A Body in the Dealer Service Information Binder

(2845)

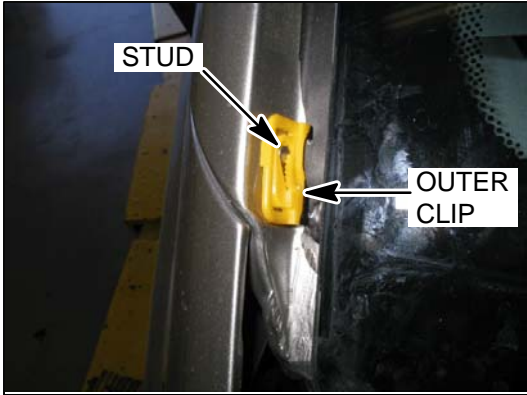

5. Be sure that the outer moulding clips (four on each side) are securely attached to the body retention stud as shown. If the clips are not properly attached, noise may result.
6. Reinstall the windshield side moulding.
7. Test drive to verify the noise is eliminated.

## PARTS INFORMATION

Use the Genuine Mitsubishi Part listed below:

Description	Part Number
BSR Kit - Contains felt, tape, and urethane padding pieces	MB991752

## WARRANTY INFORMATION

### ***Windshield Moulding Inner Clips (Both Sides)***

*Nature Code:* 81D

*Cause Code:* 600

*Labor Operation No.* 42312195

*Time Allowance:* 0.4 hr.

*Warranty Coverage:* Basic coverage (3 years/36,000 miles or 5 years/60,000 miles depending on model year and retail vehicle sale date)

*Special Warranty Information:* Normal warranty procedures apply.

**Allowable parts charge for the BSR kit (MB991752) for this repair = \$5.00**

Mitsubishi Motors North America, Inc.

The information contained in this bulletin is subject to change. For the latest version of this document, go to the Mitsubishi Dealer Link, MEDIC, or the Mitsubishi Service Information website ([www.mitsubishitechinfo.com](http://www.mitsubishitechinfo.com)).